

Data sheet article FE-Q-25-20-06

Technical data and application safety

Webcraft GmbH Industriepark 206 78244 Gottmadingen, Germany

Phone: +49 7731 939 839 1

www.supermagnete.ro support@supermagnete.ro

1. Technical information


Block magnet 25 x 20 x 6 mm, holds approx. 1,2 kg, ferrite, Y35, no coating

Article ID EAN	FE-Q-25-20-06 7640155431866	
Material	Ferrite	
Shape	Block	
Size	25 x 20 x 6 mm	
Side 1	25 mm(+/- 0,5 mm)	
Side 2	20 mm(+/- 0,4 mm)	
Side 3	6 mm(+/- 0,1 mm)	
Pole faces	25 x 20 mm	
Direction of magnetisation	6 mm	
Coating	No coating	
Manufacturing method	sintered	
Magnetisation	Y35	20 mm
Strength	approx. 1,2 kg (approx. 11,8 N)	
Displacement force	approx. 240 g (approx. 2,35 N)	25 mm
Max. working temperature	250°C	2011111
Colour	Grey	
Weight	14,5500 g	
Curie temperature	450 °C	
Residual magnetism Br	4000-4100 G, 0.40-0.41 T	
<u> </u>	2.20-2.45 kOe, 175-195 kA/m	
Coercive field strength iHc	2.26-2.51 kOe, 180-200 kA/m	
Energy product (BxH)max	3.8-4.0 MGOe, 30.0-32.0 kJ/m ³	

ROHS Product compliant with the latest European RoHS directive.

REACH Product compliant with the latest European REACH regulation.

2. Safety tips

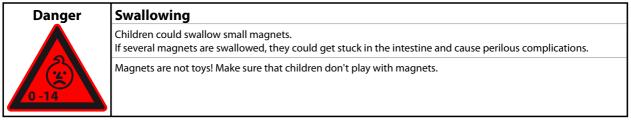



Pacemaker

Magnets could affect the functioning of pacemakers and implanted heart defibrillators.
A pacemaker could switch into test mode and cause illness.
A heart defibrillator may stop working.

If you wear these devices keep sufficient distance to magnets: www.supermagnete.ro/faq/distance
Warn others who wear these devices from getting too close to magnets.

3. Handling and storing

Magnets produce a far-reaching, strong magnetic field. They could damage TVs and laptops, computer hard Irives, credit and ATM cards, data storage media, mechanical watches, hearing aids and speakers.
Keep magnets away from devices and objects that could be damaged by strong magnetic fields. Please refer to our table of recommended distances: www.supermagnete.ro/faq/distance

Notice	Influence on people
	According to the current level of knowledge, magnetic fields of permanent magnets do not have a measurable positive or negative influence on people. It is unlikely that permanent magnets constitute a health risk, but it cannot be ruled out entirely.
	 For your own safety, avoid constant contact with magnets. Store large magnets at least one metre away from your body.

Notice	Temperature resistance	
	Ferrite magnets can be used at temperatures between -40°C and 250°C. At lower and higher temperatures they lose part of their adhesive force permanently.	
	Don't use ferrite magnets in places where they are exposed to temperatures below -40°C or above 250°C.	
Notice	Mechanical treatment	
	Ferrite magnets are brittle	

HUUILE		
	Ferrite magnets are brittle. When drilling or sawing a magnet with improper tools, the magnet may break.	
	Stay away from mechanical treatment of magnets if you do not possess the necessary equipment and experience.	

4. Transportation tips

Caution	Airfreight
Λ	Magnetic fields of improperly packaged magnets could influence airplane navigation devices. In the worst case it could lead to an accident.
	 Airfreight magnets only in packaging with sufficient magnetic shielding. Please refer to the respective regulations: www.supermagnete.ro/faq/airfreight
Caution	Postage
	Magnetic fields of improperly packaged magnets could cause disturbances in sorting machines and damage

	fragile goods in other packages.	
	 Please refer to our shipping tips: www.supermagnete.ro/faq/shipping Use a large box and place the magnet in the middle surrounded by lots of padding material. Arrange magnets in a package in a way that the magnetic fields neutralise each other. 	
		 If necessary, use sheet iron to shield the magnetic field.
	• Arrange magnets in a package in a way that the magnetic fields neutralise each other.	

For more information about magnets please review **https://www.supermagnete.ro/faqs**.

Last update: 11/05/2025